
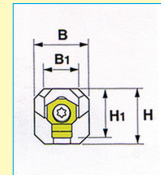
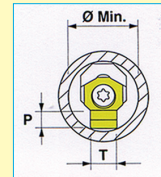
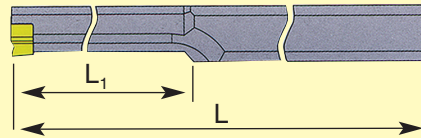


# SAFETY


## Kilesporsystem

### PHZ


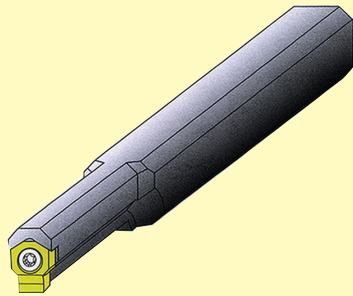


H	H1	B	B1	L1	L	T	Ø Min.	P Max			
PHZ 1104-06	11,3	9	11,3	8,5	35	160	$\frac{3}{5}$	9,5	1,8	DVF 3593	TX 207PLUS
PHZ 1107-06	11,3	10	11,3	7	60	200	$\frac{4}{5}$	10,9	2,5	DVF 3593	TX 207PLUS
PHZ 1111-06 <b>NY</b>	11,3	12	11,3	—	60	200	$\frac{4}{8}$	14	2,5	DVF 3593	TX 207PLUS
PHZ 1512-10	15,5	16,2	12	—	—	220	$\frac{6}{12}$	17,8	4,2	DVF 2260	TX 215PLUS
PHZ 2014-13	20,6	21,5	14	—	—	250	$\frac{10}{16}$	24,2	6,2	5513 020-14	TX 225PLUS
PHZ/2 3625-14	36	37,5	25	—	—	300	14	44	8	5513 020-14	TX 225 PLUS

### HZ

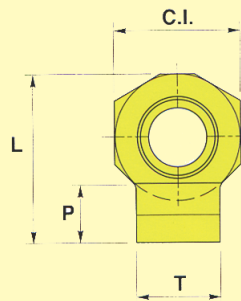

### HZ/2

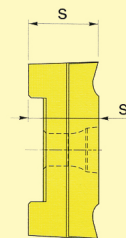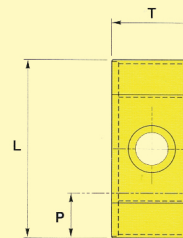

	C.i.	s	s1	L	P	T	Tolerance T
HZ 06 04- 30 C11	6	4,66	4,76	7,5	1,8	3	+0,120 +0,060
HZ 06 04- 40 C11	6	4,66	4,76	8,0	2,5	4	+0,145 +0,070
HZ 06 04- 50 C11	6	4,66	4,76	8,0	3,0	5	+0,145 +0,070
HZ 10 06- 60 C11	10	6,25	6,35	13,5	4,2	6	+0,145 +0,070
HZ 10 06- 80 C11	10	6,25	6,35	13,5	5,2	8	+0,170 +0,080
HZ 13 09-100 C11	13	9,40	9,525	18,5	6,2	10	+0,170 +0,080
HZ 13 09-120 C11	13	9,40	9,525	18,5	7,2	12	+0,205 +0,095
HZ 06 04- 30 H7	6	4,66	4,76	7,5	1,8	3	+0,01 -0
HZ 06 04- 40 H7	6	4,66	4,76	8,0	2,5	4	-0 +0,012
HZ 06 04- 50 H7	6	4,66	4,76	8,0	3,0	5	-0 +0,012
HZ 10 06- 60 H7	10	6,25	6,35	13,5	4,2	6	-0 +0,012
HZ 10 06- 80 H7	10	6,25	6,35	13,5	5,2	8	-0 +0,015
HZ 13 09-100 H7	13	9,40	9,525	18,5	6,2	10	-0 +0,015
HZ 13 09-120 H7	13	9,40	9,525	18,5	7,2	12	-0 +0,018
HZ/2 14-14C11 <b>NY</b>		13,9	14	36	8	14	+0,205
HZ/2 16-16 C11		13,9	14	36	+0,095 9 +0,095	16	+0,205
HZ/2 14-14 H7 <b>NY</b>		13,9	14	36	8	14	+0,018
HZ/2 16-16 H7		13,9	14	36	-0 9 -0	16	+0,018

## NORWEGIAN TOOLS AS ✓

TLF 09070 FAX 6924 0039  
E-mail: post@09070.com - www.09070.com